PAGE: 1 1

PRINT DATE: 03/22/94

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CRITICAL HARDWARE NUMBER: 05-6-2904-X

SUBSYSTEM NAME: ELECTRICAL POWER DISTRIBUTION AND CONTROL

REVISION: 1

03/22/94

PART NAME VENDOR NAME

PART NUMBER VENDOR NUMBER

נאט :

: AFT PCA 4,5,6

VO70-765280

SRU

: DIODE, 35 AMP

JANTX1N1188R

## PART DATA

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS: DIODE, ISOLATION, 35A - MEC 1 AND 2 INPUT POWER

REFERENCE DESIGNATORS: 54V78A134A2CR45

55V78A135A2CR45 56V76A136A2CR45 56V76A136A2CR46

QUANTITY OF LIKE ITEMS: 4

FOUR

## **FUNCTION:**

ISOLATES THE MAIN DC BUS FEEDERS TO THE MASTER EVENTS CONTROLLERS (MEC'S) 1 AND 2 POWER SUPPLY TWO INPUTS.

PAGE: 2

PRINT DATE: 03/22/94

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CRITICAL FAILURE MODE

NUMBER: 05-6-2904-02

REVISION#

03/22/94

SUBSYSTEM NAME: ELECTRICAL POWER DISTRIBUTION AND CONTROL

LRU: AFT PCA 4.5.6

CRITICALITY OF THIS

ITEM NAME: DIODE, 35 AMP.

FAILURE MODE: 1R3

FAILURE MODE:

SHORT (END TO END)

MISSION PHASE:

LO

LIFT-OFF

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA

103 DISCOVERY

104 ATLANTIS

105 ENDEAVOUR

CAUSE:

STRUCTURAL FAILURE (MECHANICAL STRESS, VIERATION), THERMAL STRESS.

CONTAMINATION, ELECTRICAL STRESS, PROCESSING ANOMALY

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

A) PASS

B) FAIL

C) PASS

PASSIFAIL RATIONALE:

A)

B)

FAILS "8" SCREEN BECAUSE SHORTED DIODES ARE NOT DETECTABLE IN FLIGHT.

C)

## - FAILURE EFFECTS .

(A) SUBSYSTEM:

LOSS OF ISOLATION BETWEEN MEC POWER FEEDERS.

(B) INTERFACING SUBSYSTEM(S):

FIRST FAILURE - NO EFFECT.

(C) MISSION:

FIRST FAILURE - NO EFFECT.

(D) CREW, VEHICLE, AND ELEMENT(S):

FIRST FAILURE - NO EFFECT.

PRINT DATE: 03/22/94 PAGE: 3

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CRITICAL FAILURE MODE NUMBER: 05-6-2904-02

(E) FUNCTIONAL CRITICALITY EFFECTS: POSSIBLE LOSS OF CREW/VEHICLE AFTER THREE ADDITIONAL FAILURES:

- (1) SHORT TO STRUCTURE (GROUND) ON SAME DIODE LOSS OF REDUNDANCY (CORE 5) FOR POWERING ONE OF TWO MASTER EVENTS CONTROLLERS.
- (2) LOSS OF CORE A ON SAME MEC RESULTING IN LOSS OF CRITICAL FUNCTIONS CONTROLLED BY THIS MED (SRB IGNITION, SRB SEPARATION OR ET/ORB SEPARATION)
- (3) LOSS OF THE REDUNDANT INITIATOR FIRED BY THE OTHER MEC.

## -DISPOSITION RATIONALE-

(A) DESIGN:

REFER TO APPENDIX F, ITEM NO. 1 - DIODE, STUD-MOUNTED

(B) TEST:

REFER TO APPENDIX F, ITEM NO. 1 - DIODE, STUD-MOUNTED

GROUND TURNAROUND TEST ANY TURNAROUND CHECKOUT TESTING IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

(C) INSPECTION:

REFER TO APPENDIX F, ITEM NO. 1 - DIODE, STUD-MOUNTED

(D) FAILURE HISTORY:

FAILURE HISTORY IS TRACKED IN THE PRACA SYSTEM.

(E) OPERATIONAL USE:

NONE

- APPROVALS -

PAE MANAGER

: K PRESTON

PRODUCT ASSURANCE ENGR: T. KIMURA

DESIGN ENGINEERING

J. GULSEY

NASA SSMA

NASA SUBSYSTEM MANAGER: